



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200

002000

D350-636-012
Job Sheet 173153



Part No: D350-636-012

Job Qty: 1 pcs

Part Name: Skidtube RH, Std Wearplates, DART (Apical) Cylindrical/Aerazur Float Comp.



Part Weight: 0 lbs

Status: Scheduled

Priority: Medium

Job Created: 2/26/18

Job Tracking No:

Due Date: 3/13/18

Created By: Linda Lacelle

Type: SOLD

Description:

Note: DWG D3492 REV E SHEET 1, D2750-042 REV G SHEETS 1,2,5,9 IPP Rev:I 02.09.25 IPP Rev:J 06-03-23 As per Rev D IPP Rev:K 06-07.13 As per dsi9343 IPP Rev:L 07-07-28 Added SS Wearplates(Rev E) JLM Verf:EC IPP Rev:M 08-04-22 DD verified:EC IPP Rev:N 08-09-23 revF DD verified:ec IPP Rev:O 09-02-06 per PAR09-010 DD verf:EC IPP Rev:P 10.06.22 revise seq110 DD verf:EC IPP Rev:Q 10.10.01 as per IIN revH DDverf:EC IPP REV:R 13.08.27 PER ECN13-594 DD VERF:JLM

Ship Via:

Bill of Materials

5047273x1 x RH

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																	
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval																																															
Description Work Order Deviation			Disposition																																																
*ed By Supervisor rification Coordinator val Wrong mensions r tolerance ect Missing d DART Aerospace Ltd. 1270 Aberdeen Street Newbury, ON K6A 1K7 CANADA TEL.: 1 813 632-6200 Email: sales@dartaero.com www.dartaero.com Date: 03/02/18 Container No: S047273 Part: D350-636-012 Job No: 173153 Serial No/Batch: S047273 Revision: Inspector:																																																			
Root Cause <table style="width:100%; border-collapse: collapse;"> <tr><td style="width:50%;">Environment ☐</td><td style="width:50%;">No Re-verification ☐</td></tr> <tr><td>Design ☐</td><td>Operator ☐</td></tr> <tr><td>Doc/Data ☐</td><td>Offset/Setup ☐</td></tr> <tr><td>Equip/Tooling ☐</td><td>Supplier ☐</td></tr> <tr><td>Handling/Pre ☐</td><td>Training ☐</td></tr> <tr><td>Material ☐</td><td>Use for Testing ☐</td></tr> <tr><td>Internal Transport ☐</td><td>Poor Information ☐</td></tr> <tr><td>Tribal Knowledge ☐</td><td>Rushing ☐</td></tr> <tr><td>LOA ☐</td><td>Product Improvement ☐</td></tr> <tr><td>Substation ☐</td><td>Process Improvement ☐</td></tr> <tr><td>Past Expiry Date ☐</td><td>Manufacturing Process ☐</td></tr> <tr><td>Misidentified ☐</td><td>Past Due ☐</td></tr> </table>		Environment ☐	No Re-verification ☐	Design ☐	Operator ☐	Doc/Data ☐	Offset/Setup ☐	Equip/Tooling ☐	Supplier ☐	Handling/Pre ☐	Training ☐	Material ☐	Use for Testing ☐	Internal Transport ☐	Poor Information ☐	Tribal Knowledge ☐	Rushing ☐	LOA ☐	Product Improvement ☐	Substation ☐	Process Improvement ☐	Past Expiry Date ☐	Manufacturing Process ☐	Misidentified ☐	Past Due ☐	<table style="width:100%; border-collapse: collapse;"> <tr><td style="width:50%;">Pressure/Force ☐</td><td style="width:50%;">Cut Too Short ☐</td></tr> <tr><td>Bending ☐</td><td>Instructions Incomplete/Unclear ☐</td></tr> <tr><td>Centre Not Con ☐</td><td>Drill Holes ☐</td></tr> <tr><td>Cracks ☐</td><td></td></tr> <tr><td>Crimp/Kink/Rip ☐</td><td></td></tr> <tr><td>Cuffs ☐</td><td></td></tr> <tr><td>Crushing ☐</td><td></td></tr> <tr><td>Heat Treat ☐</td><td></td></tr> <tr><td>Wave/Twist in Tube ☐</td><td></td></tr> <tr><td>Marks/Chatter ☐</td><td></td></tr> <tr><td colspan="2" style="text-align: center;">OTHER : ☐</td></tr> </table>				Pressure/Force ☐	Cut Too Short ☐	Bending ☐	Instructions Incomplete/Unclear ☐	Centre Not Con ☐	Drill Holes ☐	Cracks ☐		Crimp/Kink/Rip ☐		Cuffs ☐		Crushing ☐		Heat Treat ☐		Wave/Twist in Tube ☐		Marks/Chatter ☐		OTHER : ☐	
Environment ☐	No Re-verification ☐																																																		
Design ☐	Operator ☐																																																		
Doc/Data ☐	Offset/Setup ☐																																																		
Equip/Tooling ☐	Supplier ☐																																																		
Handling/Pre ☐	Training ☐																																																		
Material ☐	Use for Testing ☐																																																		
Internal Transport ☐	Poor Information ☐																																																		
Tribal Knowledge ☐	Rushing ☐																																																		
LOA ☐	Product Improvement ☐																																																		
Substation ☐	Process Improvement ☐																																																		
Past Expiry Date ☐	Manufacturing Process ☐																																																		
Misidentified ☐	Past Due ☐																																																		
Pressure/Force ☐	Cut Too Short ☐																																																		
Bending ☐	Instructions Incomplete/Unclear ☐																																																		
Centre Not Con ☐	Drill Holes ☐																																																		
Cracks ☐																																																			
Crimp/Kink/Rip ☐																																																			
Cuffs ☐																																																			
Crushing ☐																																																			
Heat Treat ☐																																																			
Wave/Twist in Tube ☐																																																			
Marks/Chatter ☐																																																			
OTHER : ☐																																																			

Job Routing

Op No	Operation	Qty	Start Date	Due Date	Standard		Workcenter/Supplier		Sign-off
					Setup hrs	Run Hrs	Workcenter / Supplier	Lead Time	
90	Start up Operation	1 Ea		3/12/18	0.00	0.00	Start Up Skidtubes-1		
110	Skidtubes	1 pcs		3/12/18	0.00	4.36	Skidtubes-4		
120	QC	1 pcs		3/12/18	0.00	0.00	QC10		
130	QC	1 pcs		3/12/18	0.00	0.00	QC5		
140	HandFinish	1 pcs		3/12/18	0.00	0.91	HandFinish1		
150	QC	1 pcs		3/12/18	0.00	0.00	QC7-2		
160	Skidtubes	1 pcs		3/12/18	0.00	4.36	Skidtubes-1		
170	QC	1 pcs		3/12/18	0.00	0.00	QC10		
180	QC	1 pcs		3/12/18	0.00	0.00	QC5		
190	HandFinish	1 pcs		3/12/18	0.00	0.91	HandFinish2		
200	SprayPaint	1 pcs		3/12/18	0.00	0.69	Spray Paint		
210	QC	1 pcs		3/12/18	0.00	0.00	QC14		
230	HandFinish	1 pcs		3/13/18	0.00	0.91	HandFinish4		
240	QC	1 pcs		3/13/18	0.00	0.00	QC5		
250	Packaging	1 pcs		3/13/18	0.00	0.00	Packaging1-3		
260	QC	1 pcs		3/13/18	0.00	0.00	QC4		
265	DC	1 pcs		3/13/18	0.00	0.00	DC		
270	Packaging	1 pcs		3/13/18	0.00	0.00	Packaging3-1		
280	QC21-FG	1 Ea		3/13/18	0.00	0.00	QC21		
330	Packaging	1 pcs		3/13/18	0.00	0.00	Packaging2		

Part Op 110 - 1- Pick D2600-3 Bent Drill pilot holes as per Dwg D2750 sheet 4 (D2750-2 details). Drill using drill Jig DT8150 &

Descriptions: DT8863A for second side only DT8863B for first side (detail K) 4- Locate DT8329 off of blade fitting bolt holes and drill pilot holes for blade fitting. Open to 0.500" using hole saw. VERIFY AND RECORD FWD BEND ANGLE. 6- Drill pilot holes for wearplates as per Dwg D2750 using DT8108 open to 0.297". 7- Open up holes of Detail J to 0.297" (total of 2 holes per side) 8- Weld D2744 Cap as per Dwg D2750 and QSI 004. Fill grooves in bend left from bending as per QSI 004 9- Grind welds flush as per Dwg D2750

160 - 1- Open up holes of Detail L using hole saw and ground handling to 0.625" (total of 8 holes per side) as per dwg D2750. 2- Open up holes of Detail K using hole saw to 0.750" (total of 4 holes per side) as per dwg D2750. 3- Open float holes using uni-bit to .500" (4 per Side) 4- Chamfer holes of Detail K, L, ground handling and float holes per dwg D2750 (welding instructions on sheet 9) 5- Deburr and blow out all chips from inside of tube 6- Prepare tube for welding, remove alodine as required. 7- Bond web D2739 in place as per QSI 015, let cure for 12hrs. A/R Sikaflex-291 batch: M170 787 exp. date: AP 2/15 **ATTN: USE I-BEAM LOCATION AID (BLADE FITTING)** 8- Weld spacers D3490-1, D3490-3 and D2743 as per dwg D2750 & QSI004 (welding instructions on sheet 9) A/R Aluminum Rod batch: M138 690 9- At section AP-AP drill out x-bolt spacer to 0.404" 10-Grind welds flush as per Dwg D2750 11- Spot face ground handling holes section (total of 4 places per side) as per dwg D2750 12- Deburr holes, ensure tube is free of all scratches before sending to paint.

180 - ***VERIFY C'BOARD IS GOOD***

190 - Re-alodine tube as per QSI 005 section 4.1.2.1 do not acid etch.

200 - 1- PRIME AS PER DWG AND QSI 005 4.2 PRIMER PRC DESOTO 515X349 BATCH: M138 787 2-

PAINT WHITE AS PER DWG AND QSI 005 4.2 PAINT BATCH: M138 787

210 - Inspect for foreign object per QSI 024

230 - 1-Install inserts as per dwg D2750 2-Inspect for Foreign Objects 3-Install blade fitting D3488-042, wearshoes and ground handling hardware as per dwg D2750 SIKA FLEX 241 BATCH: M138 787 EXP DATE: 18-04 4- assemble o'ring to plug as per dwg D3492 and apply o'ring lube A/R 55-o'ring lube batch: M135 477 5-Coat all exposed fasteners with "LPS Procyon" batch: M138 690

265 - record fwd angle: 89.8° Photocopy blue file and type labels per PPP D350-636-012 CHG 007

270 - Package as per PPP D350-636-012

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																										
Description Work Order Deviation				Disposition				Completed By																																																									
								Lead hand / Supervisor Approval Verification																																																									
								QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____			
Misidentified ☐	Past Due ☐																																																																

Job BOM

Part / Item	Component Name	Quantity	Operation	Container
D2600-3-BENT-RH	Extrusion Bent RH	1 Ea (1 ea)	90-Start up Operation	5043941
D2744	Cap	1 Ea (1 ea)	90-Start up Operation	5038835
D2739	350 I-Beam	1 Ea (1 ea)	160-Skidtubes	5040982
D2743	Crossbolt Spacer	8 Ea (8 ea)	160-Skidtubes	3000649
D3490-1	Cross Bolt Spacer	4 Ea (4 ea)	160-Skidtubes	5039369
D3490-3	Cross Bolt Spacer	4 Ea (4 ea)	160-Skidtubes	5040318
ALS4-1032-225	Rivnut	38 Ea (38 ea)	230-HandFinish	
AN3C5A	Bolt	34 Ea (34 ea)	230-HandFinish	
AN3C6A	Bolt	4 Ea (4 ea)	230-HandFinish	
AN6C44A	Bolt	4 Ea (4 ea)	230-HandFinish	
AN8C35A	Bolt	1 Ea (1 ea)	230-HandFinish	
D2745	Bushing	8 Ea (8 ea)	230-HandFinish	
D3488-042	Blade Fitting RH	1 Ea (1 ea)	230-HandFinish	
D3492-1	Plug	8 Ea (8 ea)	230-HandFinish	
D3492-3	Plug	8 Ea (8 ea)	230-HandFinish	
D3535-25	Wearplate Center	1 Ea (1 ea)	230-HandFinish	
D3536-25	Gasket Center	1 Ea (1 ea)	230-HandFinish	
D3537-1	Wearpad	3 Ea (3 ea)	230-HandFinish	
D3631-1	Washer	8 Ea (8 ea)	230-HandFinish	
D3791-1	Wearpad	1 Ea (1 ea)	230-HandFinish	
D3793-1	Wearplate Fwd	1 Ea (1 ea)	230-HandFinish	
D3793-3	Wearplate Aft	1 Ea (1 ea)	230-HandFinish	
D3794-1	Gasket Fwd	1 Ea (1 ea)	230-HandFinish	
D3794-3	Gasket Aft	1 Ea (1 ea)	230-HandFinish	
MS21043-6	Nut	4 Ea (4 ea)	230-HandFinish	
MS21083C8	Nut	1 Ea (1 ea)	230-HandFinish	
NAS1149C0332R	Washer	38 Ea (38 ea)	230-HandFinish	
NAS1149C0832R	Washer	1 Ea (1 ea)	230-HandFinish	
NAS1515H3L	Washer	4 Ea (4 ea)	230-HandFinish	
NAS1611-010	O-Ring	8 Ea (8 ea)	230-HandFinish	
NAS1611-013	O-Ring	8 Ea (8 ea)	230-HandFinish	
AN8C21A	Bolt	2 Ea (2 ea)	250-Packaging	FM137162
D2741	Replacement Blade	1 Ea (1 ea)	250-Packaging	5163260-1
D3493-1	Washer	2 Ea (2 ea)	250-Packaging	5031096
D3532-1	Spacer	2 Ea (2 ea)	250-Packaging	5040493
MS21083C8	Nut	2 Ea (2 ea)	250-Packaging	5016888
NAS1149D0863J	Washer	2 Ea (2 ea)	250-Packaging	F125635

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

Job Allocations				
Operation	Component Part	Required	Inventory	Allocated
90-Start up Operation	D2600-3-BENT-RH	1	16	0
	D2744	1	28	0
160-Skidtubes	D2739	1	27	0
	D2743	8	151	0
	D3490-1	4	128	0
	D3490-3	4	107	0
	ALS4-1032-225 <i>5048375</i>	38	1,015	0
230-HandFinish	AN3C5A <i>5019396</i>	34	805	0
	AN3C6A <i>5019397</i>	4	170	0
	AN6C44A <i>FM137055</i>	4	447	0
	AN8C35A <i>FM137203</i>	1	73	0
	<i>7x5053257</i> D2745 <i>5026936x1</i>	8	105	0
	D3488-042 <i>5040148</i>	1	14	0
	D3492-1 <i>5044324</i>	8	199	0
	D3492-3 <i>5026057</i>	8	152	0
	D3535-25 <i>5047122</i>	1	23	0
	D3536-25 <i>5047787</i>	1	19	0
	D3537-1 <i>5037408</i>	3	103	0
	D3631-1 <i>5048060</i>	8	54	0
	D3791-1 <i>5049290</i>	1	11	0
	D3793-1 <i>5047586</i>	1	27	0
	D3793-3 <i>5041206</i>	1	30	0
	D3794-1 <i>5046363</i>	1	20	0
	D3794-3 <i>5046244</i>	1	10	0
	MS21043-6 <i>5053037</i>	4	119	0
	MS21083C8 <i>5034401</i>	1	91	0
	NAS1149C0332R <i>5044236</i>	38	4,688	0
	<i>1x5036714</i> NAS1149C0832R <i>M138409-121</i>	1	98	0
	NAS1515H3L <i>FM137316-25x3</i>	4	295	0
	NAS1611-010 <i>5049970</i>	8	279	0
	NAS1611-013 <i>1138441-122</i>	8	367	0
250-Packaging	AN8C21A	2	166	0
	D2741	1	81	0
	D3493-1	2	40	0
	D3532-1	2	56	0
	MS21083C8	2	91	0
	NAS1149D0863J	2	167	0
Part Specifications				
Specifications could not be found.				

Plex 2/26/18 1:55 PM dart.lacelle.linda

061984

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QS1042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER :							
Misidentified ☐	Past Due ☐								

QTY -041	QTY -042	QTY -043	QTY -044	PART NUMBER	DESCRIPTION
X				D2750-041	350 SKIDTUBE ASSEMBLY, LH
	X			D2750-042	350 SKIDTUBE ASSEMBLY, RH
		X		D2750-043	350 SKIDTUBE ASSEMBLY, LH
			X	D2750-044	350 SKIDTUBE ASSEMBLY, RH
1	1	1	1	D2739	WEB
8	8	8	8	D2743	SPACER
1	1	1	1	D2744	CAP
8	8	8	8	D2745	BUSHING
1				D2750-1	SKIDTUBE WELDMENT, LH
	1			D2750-2	SKIDTUBE WELDMENT, RH
		1		D2750-3	SKIDTUBE WELDMENT, LH
			1	D2750-4	SKIDTUBE WELDMENT, RH
1		1		D3488-041	BLADE FITTING, LH
	1		1	D3488-042	BLADE FITTING, RH
4	4	4	4	D3490-1	SPACER
4	4			D3490-3	SPACER
		4	4	D3490-5	SPACER
8	8	8	8	D3492-041	PLUG ASSEMBLY
8	8			D3492-043	PLUG ASSEMBLY
		8	8	D3492-045	PLUG ASSEMBLY
1	1	1	1	D3535-25	WEARSHOE
1	1	1	1	D3536-25	GASKET
3	3	3	3	D3537-1	WEARPAD
8	8	8	8	D3631-1	WASHER
1	1	1	1	D3791-1	WEARPLATE
1	1	1	1	D3793-1	WEARSHOE
1	1	1	1	D3793-3	WEARSHOE
1	1	1	1	D3794-1	GASKET
1	1	1	1	D3794-3	GASKET
38	38	38	38	ALS4-1032-225	INSERT (OR ALS7-1032-225, AKS4-1032-225, AELS-1032-225)
34	34	34	34	AN3C5A	BOLT
4	4	4	4	AN3C6A	BOLT
4	4	4	4	AN8C44A	BOLT
1	1	1	1	AN8C35A	BOLT
38	38	38	38	AN960C10L	WASHER
1	1	1	1	AN960C816L	WASHER
4	4	4	4	MS21043-6	NUT
1	1	1	1	MS21083C8	NUT
4	4	4	4	NAS1515H3L	WASHER

GENERAL NOTES:

- MATERIAL: MAKE D2750-1/-2/-3/-4 FROM D2600-3 EXTRUSION (INITIAL LENGTH = 120.0).
- FINISH: ACID ETCH, ALODINE ASSEMBLY PER DART QSI 005 4.1 PRIOR TO INSTALLING D2739 WEB.
STANDARD: PRIME (REF. 4.2.1.3.3) AND PAINT WHITE PER DART QSI 005 4.2
OPTIONAL: POWDER COAT WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED TO 1.0 ABOVE SKIDTUBE CENTER-LINE PER DART 005 4.4 (OPTIONAL).
- TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- UNITS: INCHES UNLESS OTHERWISE NOTED
- BREAK SHARP EDGES: N/A
- IDENTIFICATION: N/A
- WEIGHT: D2750-041/-042/-043/-044 = 26.5 LBS
- WELD PER DART QSI 004
- INSTALL ALS4-1032-225 INSERTS AFTER FINISH AS INDICATED. DRILL 'F' SIZE HOLES ($\phi 0.297$) FOR WEARSHOE INSERTS
- FINAL CONFIGURATION SHOULD HAVE THE FOLLOWING MINIMUM MECHANICAL PROPERTIES:
MINIMUM YIELD TENSILE STRENGTH = 35 KSI
MINIMUM ULTIMATE TENSILE STRENGTH = 38 KSI
- COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF
FINISH WITH MEK DEGREASER.
- SPACER AND PLUG INSTALLED SAME AS SECTION AJ-AJ EXCEPT HORIZONTAL
- SPACER AND PLUG INSTALLED SAME AS SECTION AP-AP EXCEPT HORIZONTAL

Wb 173153

RELEASED
2013-08-13

G	CORRECTED TOLERANCE ON $\phi 0.500$ THRU HOLE: IS $+0.010/-0.000$, WAS $+0.100/-0.000$ (ZN B3-4, B2-5); ADD VIEW TO CONTROL FWD BEND ORIENTATION (ZN D-1-4/-5/-6/-7); UPDATED FINISH OPTIONS; INSIDE OF TUBE NO LONGER SPRAYED WITH LPS-3; REASON: PAR13-276 AND NCR13-2757	MB	13.07.11
F	INCORPORATE DSI 9413; QTY (3) D3537-1 WAS QTY (5) (ZN C8-1); D3791-1/-3 REPLACES D3535-13/-35 (ZN C8-1); D3794-1/-3 REPLACES D3536-13/-35 (ZN B8-1); ADD D3791-1 (ZN C8-1); WEARSHOE HOLES UNDER FWD/AFT SADDLE REMOVED (8 PL); WEARSHOE HARDWARE QTY UPDATED (ZN B8-1); D3488-041/-042 HARDWARE UPDATED (ZN C1-8, 9, 10, 11); ADD NOTE 12 AND 13 (ZN A6-1); REASON: REF. NCR 08-043	PH	08.07.16
E	CHANGE TO STAINLESS STEEL WEARPLATES; ADD RUBBER GASKETS; CHANGE INSERTS; ADD D3631-1; REMOVE QTY (38) NAS1515H3L; REMOVE QTY (10) NAS1515H8L; REMOVE D2741; QTY (2) AN960C816; REMOVE QTY (2) MS21083C8	CB	07.05.17
D	ADD HOLES AND SPACERS FOR APICAL FLOATS; INCORPORATE DEO 9133/8157	PH	06.01.05
C	ADD D2750-3/D2750-4; INCORPORATE D2738 AND D2740	CP	98.11.18
B	CHANGE MS24694-S293 TO AN8-16A	CP	98.09.01
A	NEW ISSUE	DS	98.04.16
REV.	DESCRIPTION	BY	DATE
DESIGN	MM		
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	13.07.11		

DART AEROSPACE USA, INC.
KENT, WA

DRAWING NO.
D2750
TITLE
350 SKIDTUBE ASSEMBLY
REV. G
SHEET 1 OF 11
SCALE
NTS
COPYRIGHT © 1998 BY DART AEROSPACE USA, INC.
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR DISCLOSED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					

Root Cause				FAULT CATEGORY			
Environment ☐		No Re-verification ☐		Pressure/Forced ☐		Temperature/Cure ☐	
Design ☐		Operator ☐		Bending ☐		Set-up ☐	
Doc/Data ☐		Offset/Setup ☐		Centre Not Concentric ☐		BOM/Route ☐	
Equip/Tooling ☐		Supplier ☐		Cracks ☐		Broken/Damage/Defect ☐	
Handling/Pre ☐		Training ☐		Crimp/Kink/Ripple/Wave ☐		Inspection Incomplete/Unqualified ☐	
Material ☐		Use for Testing ☐		Cuffs ☐		Contamination ☐	
Internal Transport ☐		Poor Information ☐		Crushing ☐		Countersink ☐	
Tribal Knowledge ☐		Rushing ☐		Heat Treat ☐		Cut Too Short ☐	
LOA ☐		Product Improvement ☐		Wave/Twist in Tube ☐		Instructions Incomplete/Unclear ☐	
Substation ☐		Process Improvement ☐		Marks/Chatter ☐		Drill Holes ☐	
Past Expiry Date ☐		Manufacturing Process ☐		OTHER : _____			
Misidentified ☐		Past Due ☐					

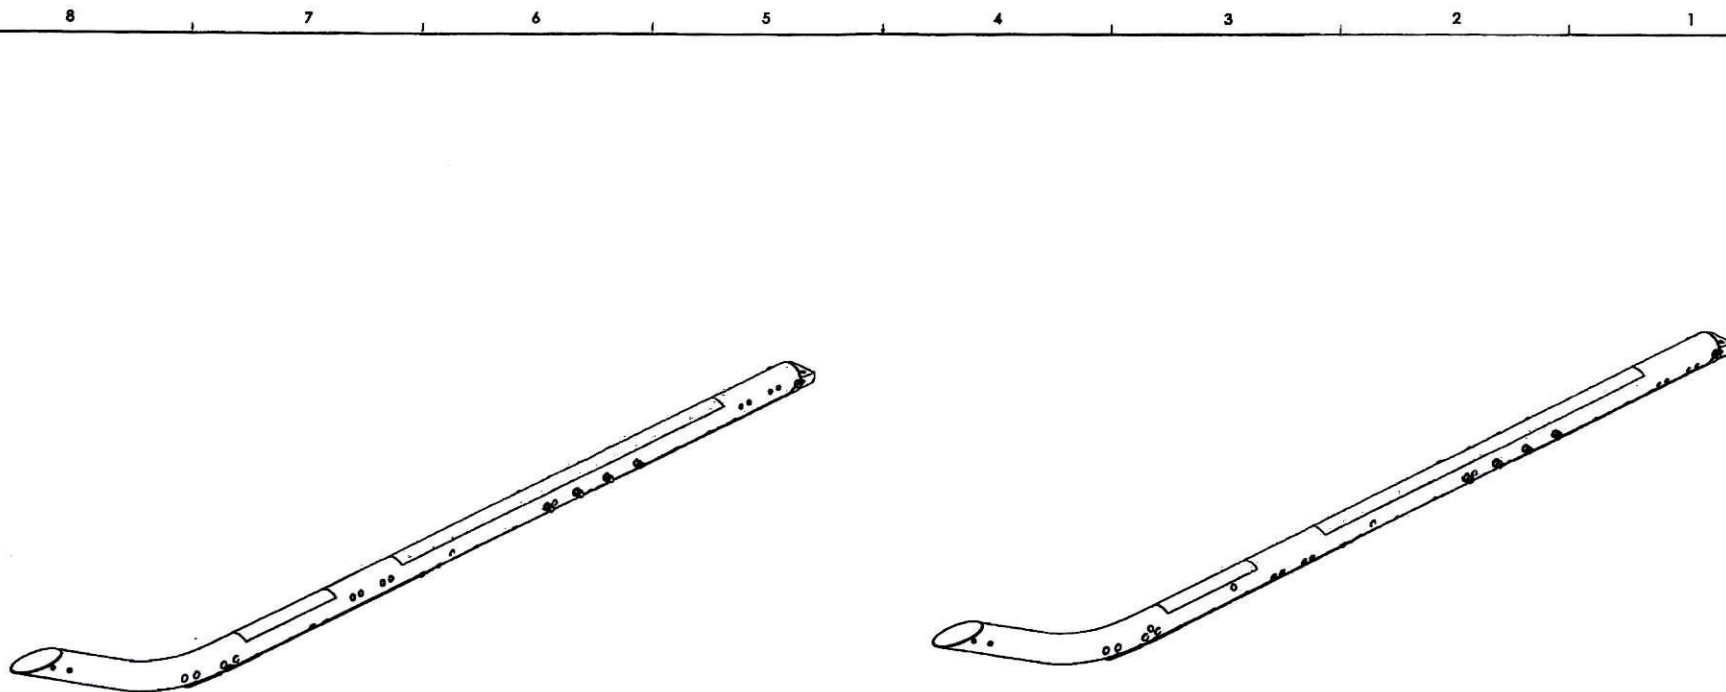

D2750-041 350 SKIDTUBE ASSEMBLY, LH

D2750-042 350 SKIDTUBE ASSEMBLY, RH

RELEASED
2013-08-13
MP

DESIGN	MM	DART AEROSPACE USA, INC.	
DRAWN		KENT, WA	
CHECKED		DRAWING NO. D2750	REV. G
MFG. APPR.		SHEET 2 OF 11	
APPROVED		TITLE	SCALE
DE APPR.		350 SKIDTUBE ASSEMBLY	NTS
DATE	13.07.11	COPYRIGHT © 1988 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR REPRODUCED OR COPIED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____


Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					


8 7 6 5 4 3 2 1

D
C
B
A

D
C
B
A

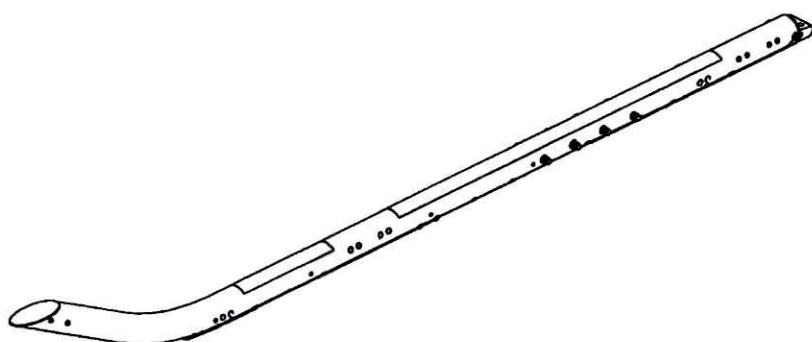

D2750-043 350 SKIDTUBE ASSEMBLY, LH

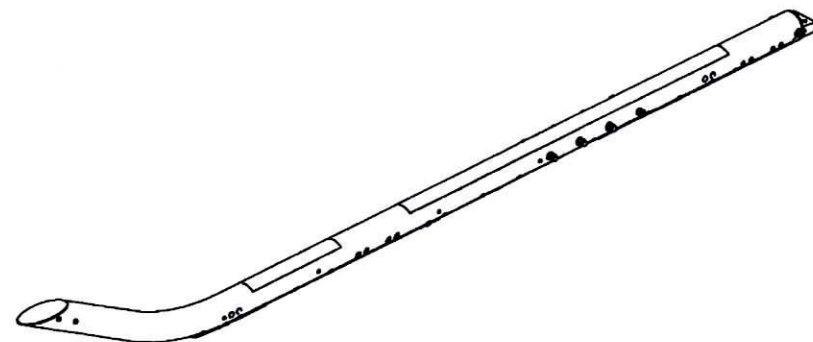

D2750-044 350 SKIDTUBE ASSEMBLY, RH

RELEASED
2013-08-13
WDP

DESIGN	MM	DART AEROSPACE USA, INC.	
DRAWN	<i>[Signature]</i>	KENT, WA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. G
MFG. APPR.	<i>[Signature]</i>	D2750	SHEET 3 OF 11
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	350 SKIDTUBE ASSEMBLY	NTS
DATE	13.07.11	COPYRIGHT © 1986 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

8 7 6 5 4 3 2 1

DQA: _____ Date: _____





WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____


Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐				
OTHER : ☐					


8 7 6 5 4 3 2 1

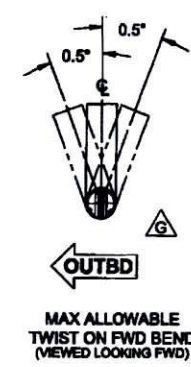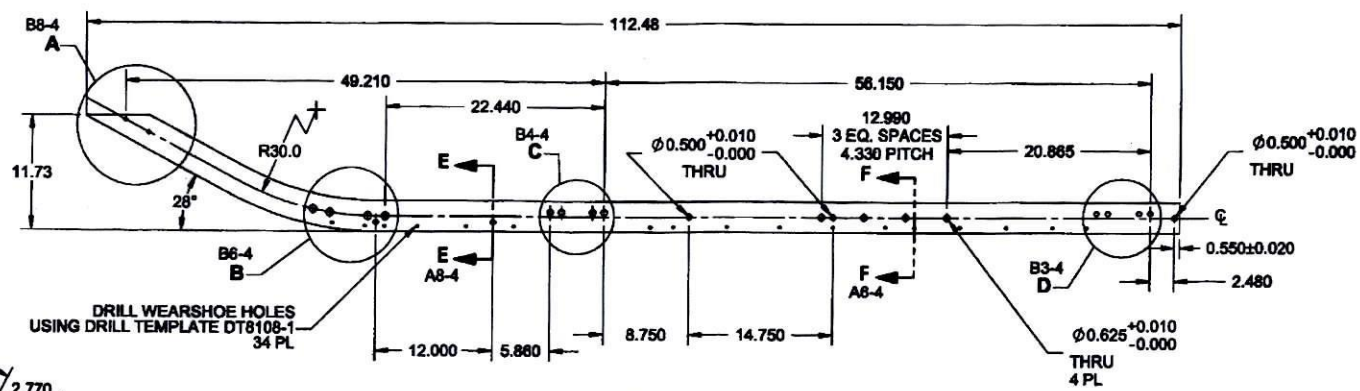


D2750-1 LH SKIDTUBE

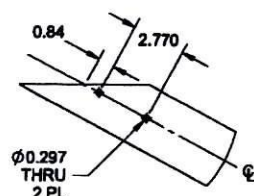


DETAIL A
SCALE 2X

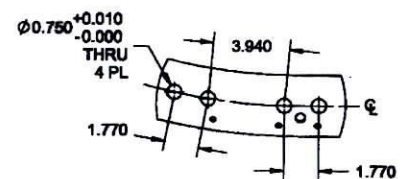


DETAIL B
SCALE 2X

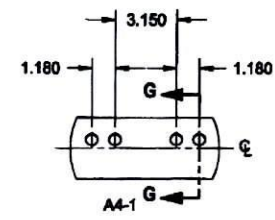


DETAIL C
SCALE 2X

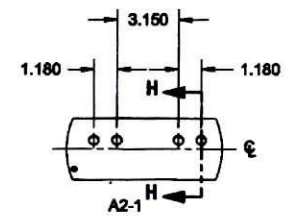


DETAIL D
SCALE 2X

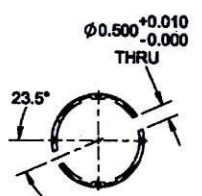


SECTION E-E
SCALE 3X, 2 PL

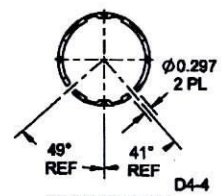

SECTION F-F
SCALE 3X, 17 PL

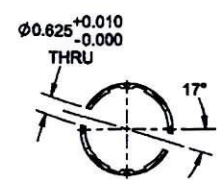

SECTION G-G
SCALE 3X, 4 PL

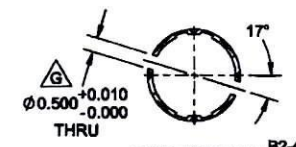

SECTION H-H
SCALE 3X, 4 PL

RELEASED
2013-08-13

DESIGN	MM	DART AEROSPACE USA, INC.	
DRAWN		KENT, WA	
CHECKED		DRAWING NO. D2750	REV. G
MFG. APPR.		SHEET 4 OF 11	
APPROVED		TITLE	SCALE
DE APPR.		350 SKIDTUBE ASSEMBLY	NTS
DATE	13.07.11	COPYRIGHT © 1986 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRESENTED AND CONSIDERED, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR FOR ANY OTHER PURPOSE WITHOUT THE WRITTEN PERMISSION OF DART AEROSPACE USA, INC.	

8 7 6 5 4 3 2 1

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐


Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

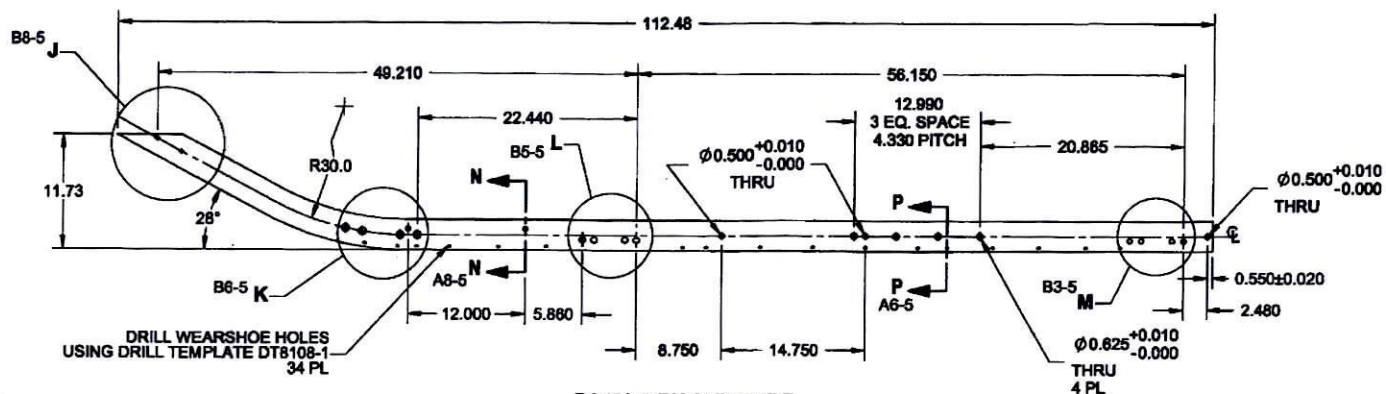


D2750-2 RH SKIDTUBE

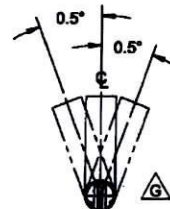


OUTBD
MAX ALLOWABLE
TWIST ON FWD BEND
(VIEWED LOOKING FWD)

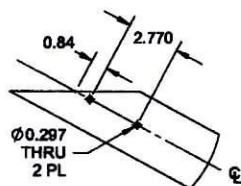


DETAIL J
SCALE 2X

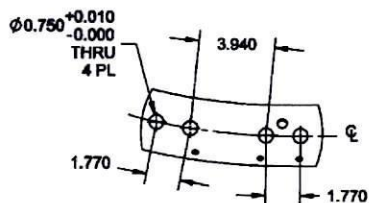


DETAIL K
SCALE 2X

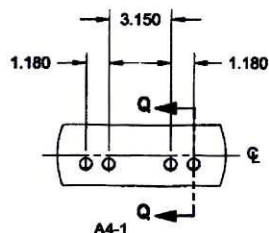


DETAIL L
SCALE 2X

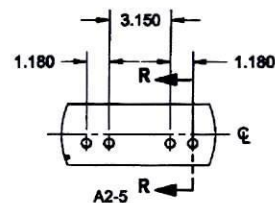


DETAIL M
SCALE 2X

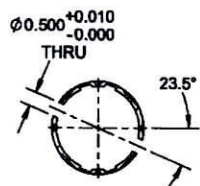


SECTION N-N
SCALE 3X, 2 PL

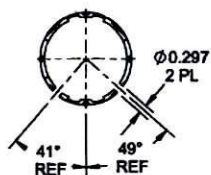

SECTION P-P
SCALE 3X, 17 PL

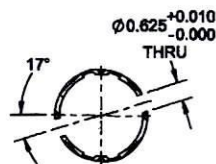

SECTION Q-Q
SCALE 3X, 4 PL

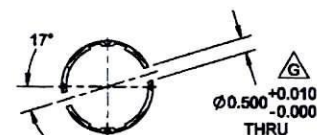

SECTION R-R
SCALE 3X, 4 PL

RELEASED
2013-08-13

DESIGN	MM	DART AEROSPACE USA, INC.
DRAWN		KENT, WA
CHECKED		DRAWING NO. D2750
MFG. APPR.		REV. G
APPROVED		SHEET 5 OF 11
DE APPR.		TITLE 350 SKIDTUBE ASSEMBLY
DATE	13.07.11	SCALE NTS

COPYRIGHT © 1986 BY DART AEROSPACE USA, INC.
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE REPRODUCED FOR ANY PURPOSES OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DQA: _____ Date: _____





WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____


Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐		OTHER : _____					


8 7 6 5 4 3 2 1

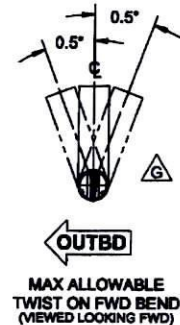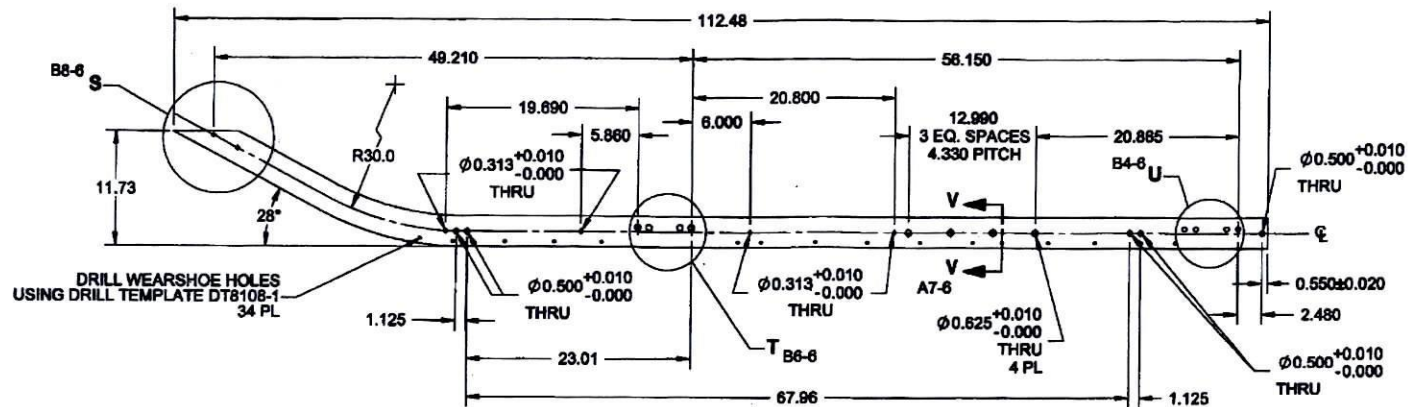


D2750-3 LH SKIDTUBE

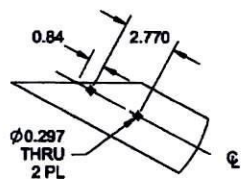


DETAIL S
SCALE 2X

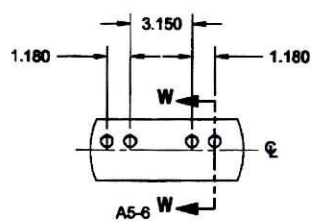


DETAIL T
SCALE 2X

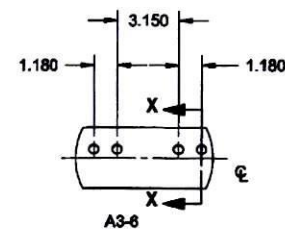


DETAIL U
SCALE 2X

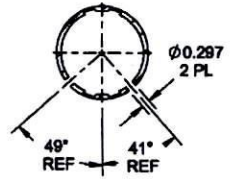

SECTION V-V
SCALE 3X, 17 PL

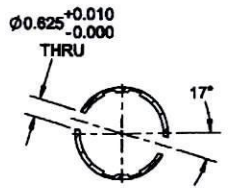

SECTION W-W
SCALE 3X, 4 PL

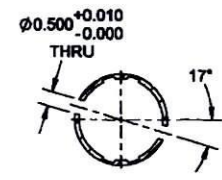

SECTION X-X
SCALE 3X, 4 PL

RELEASED
2013-08-13

DESIGN	MM	DART AEROSPACE USA, INC.	
DRAWN		KENT, WA	
CHECKED		DRAWING NO.	REV. G
MFG. APPR.		D2750	SHEET 8 OF 11
APPROVED		TITLE	SCALE
DE APPR.		350 SKIDTUBE ASSEMBLY	NTS
DATE	13.07.11	COPYRIGHT © 1988 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRELIMINARY AND CONFIDENTIAL. IT IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR DISCLOSED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

8 7 6 5 4 3 2 1

DQA: _____ Date: _____






WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐


Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																										
Description Work Order Deviation				Disposition				Completed By																																																									
								Lead hand / Supervisor Approval Verification																																																									
								QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER :			
Misidentified ☐	Past Due ☐																																																																

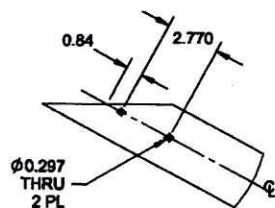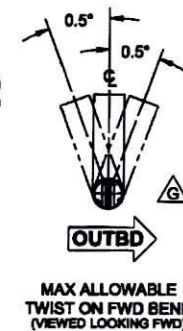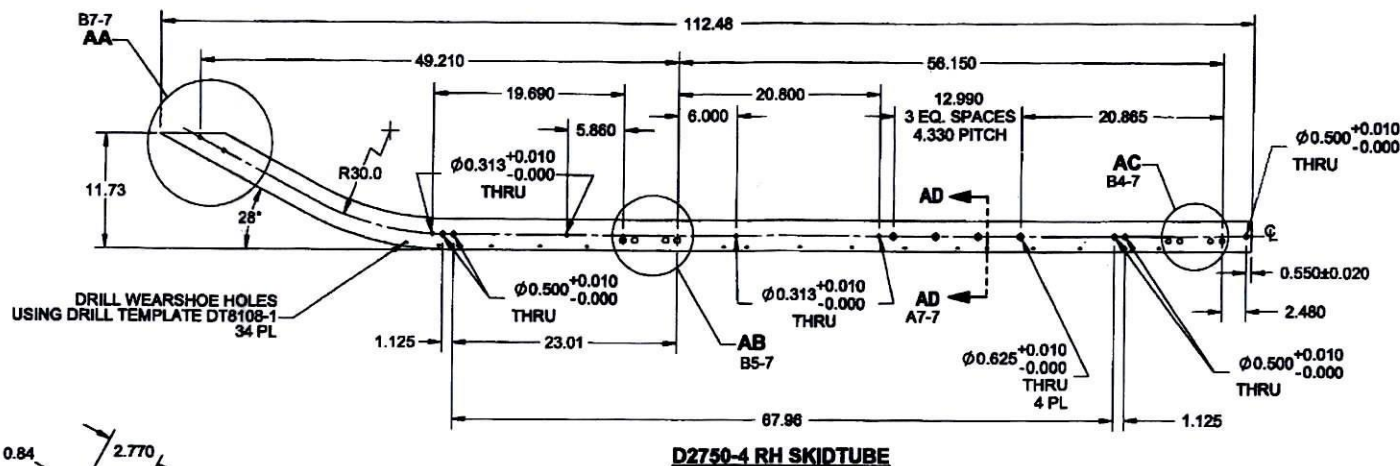


DETAIL AA
SCALE 2X

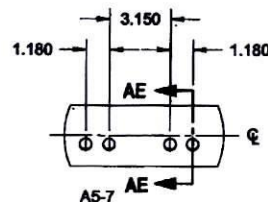


DETAIL AB
SCALE 2X

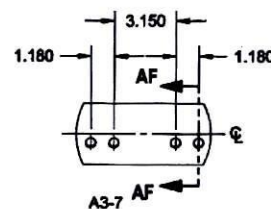


DETAIL AC
SCALE 2X

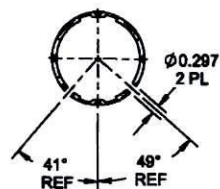

SECTION AD-AD
SCALE 3X, 17 PL

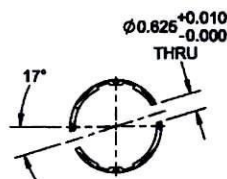

SECTION AE-AE
SCALE 3X, 4 PL

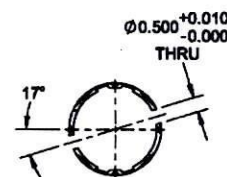

SECTION AF-AF
SCALE 3X, 4 PL

RELEASED
2013-08-13

DESIGN	MM	DART AEROSPACE USA, INC.
DRAWN		KENT, WA
CHECKED		DRAWING NO. D2750
MFG. APPR.		REV. G
APPROVED		SHEET 7 OF 11
DE APPR.		TITLE 350 SKIDTUBE ASSEMBLY
DATE	13.07.11	SCALE NTS

COPYRIGHT © 1998 BY DART AEROSPACE USA, INC.
THIS DOCUMENT IS UNCLASSIFIED AND IS SUPPLIED ON THE CONDITION THAT IT IS NOT TO BE REPRODUCED OR TRANSMITTED IN ANY FORM OR BY ANY MEANS, ELECTRONIC OR MECHANICAL, INCLUDING PHOTOCOPYING, RECORDING, OR BY ANY INFORMATION STORAGE AND RETRIEVAL SYSTEM, WITHOUT PERMISSION FROM DART AEROSPACE USA, INC.

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																										
Description Work Order Deviation				Disposition				Completed By																																																									
								Lead hand / Supervisor Approval Verification																																																									
								QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER :			
Misidentified ☐	Past Due ☐																																																																

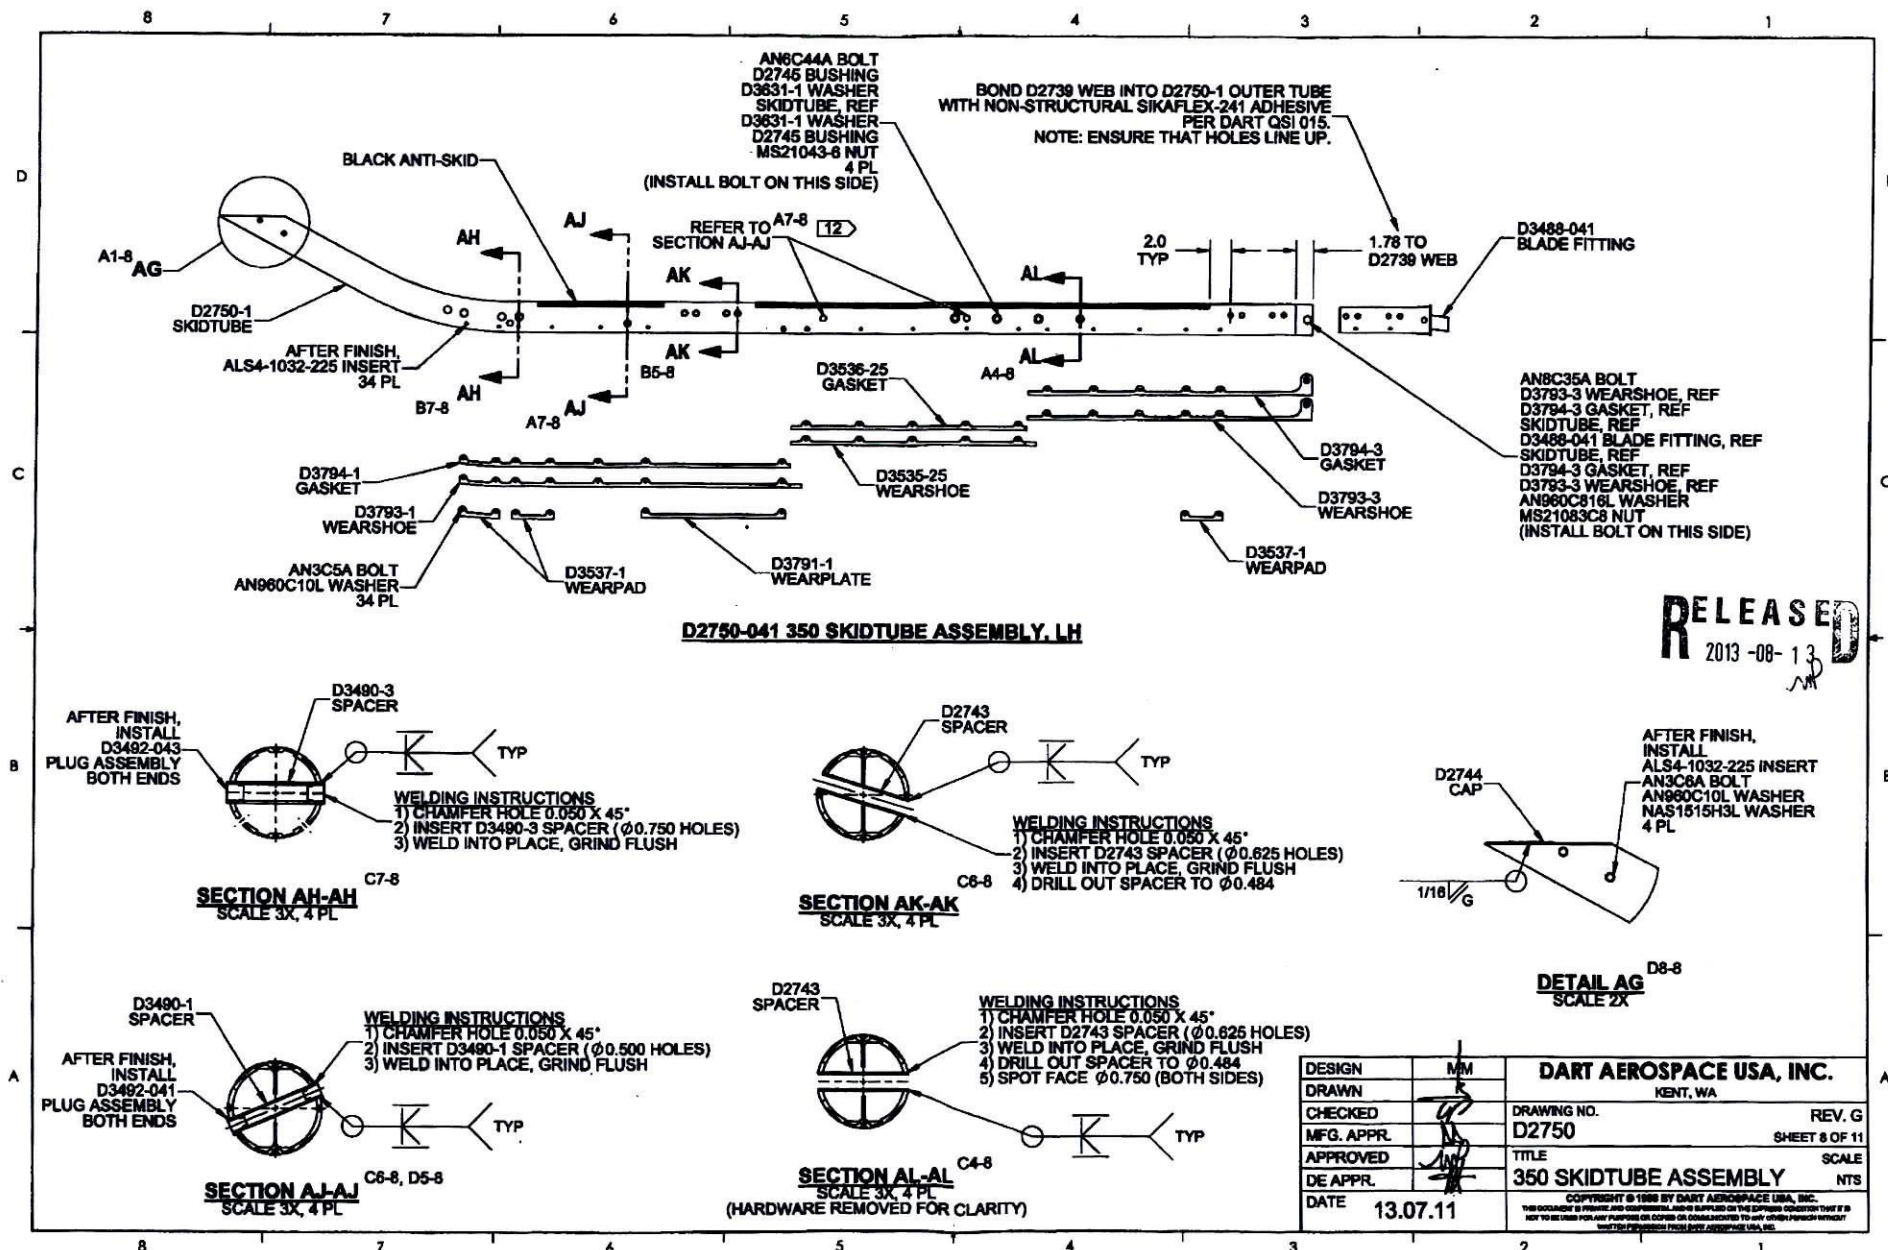

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐


Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

8 7 6 5 4 3 2 1

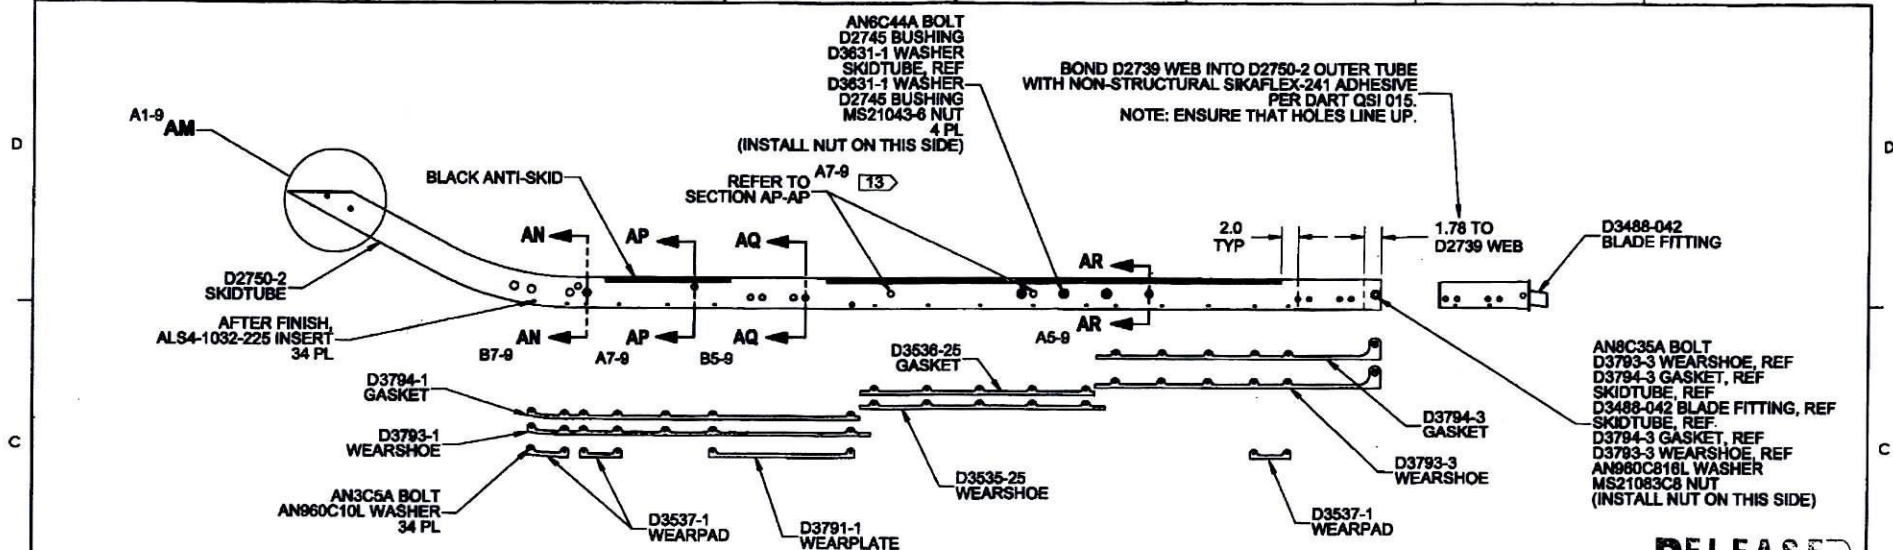


D2750-042 350 SKIDTUBE ASSEMBLY, RH


RELEASED
2013-08-13

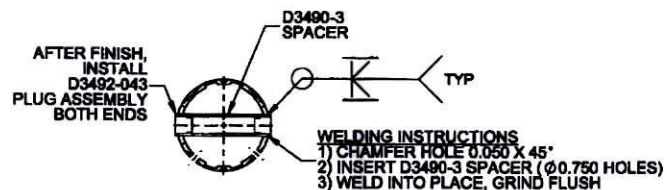


SECTION AN-AN
SCALE 3X, 4 PL

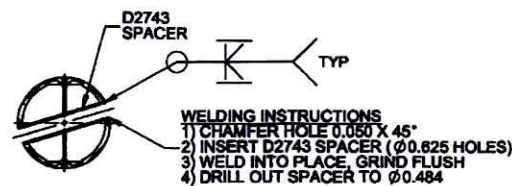


SECTION AQ-AQ
SCALE 3X, 4 PL

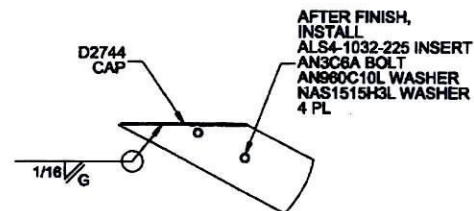

DETAIL AM
SCALE 2X

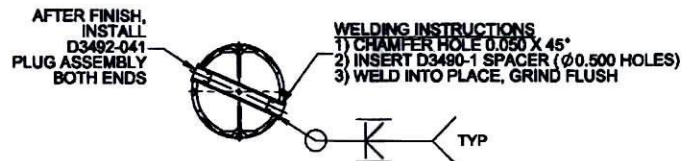

SECTION AP-AP
SCALE 3X, 4 PL

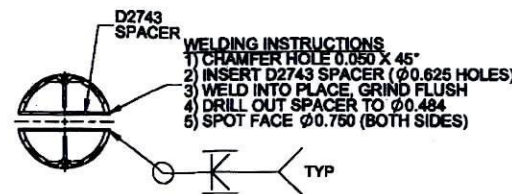

SECTION AR-AR
SCALE 3X, 4 PL
(HARDWARE REMOVED FOR CLARITY)

DESIGN	MM	DART AEROSPACE USA, INC.	
DRAWN		KENT, WA	
CHECKED		DRAWING NO. D2750	REV. G
MFG. APPR.		TITLE	SHEET 9 OF 11
APPROVED		350 SKIDTUBE ASSEMBLY	SCALE
DE APPR.			NTS
DATE	13.07.11	COPYRIGHT © 1989 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS UNCLASSIFIED AND IS AVAILABLE TO THE PUBLIC ON THE CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR IN ANY MANNER THAT WOULD BE DETRIMENTAL TO THE NATIONAL DEFENSE.	

8 7 6 5 4 3 2 1

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																										
Description Work Order Deviation				Disposition				Completed By																																																									
								Lead hand / Supervisor Approval Verification																																																									
								QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____			
Misidentified ☐	Past Due ☐																																																																

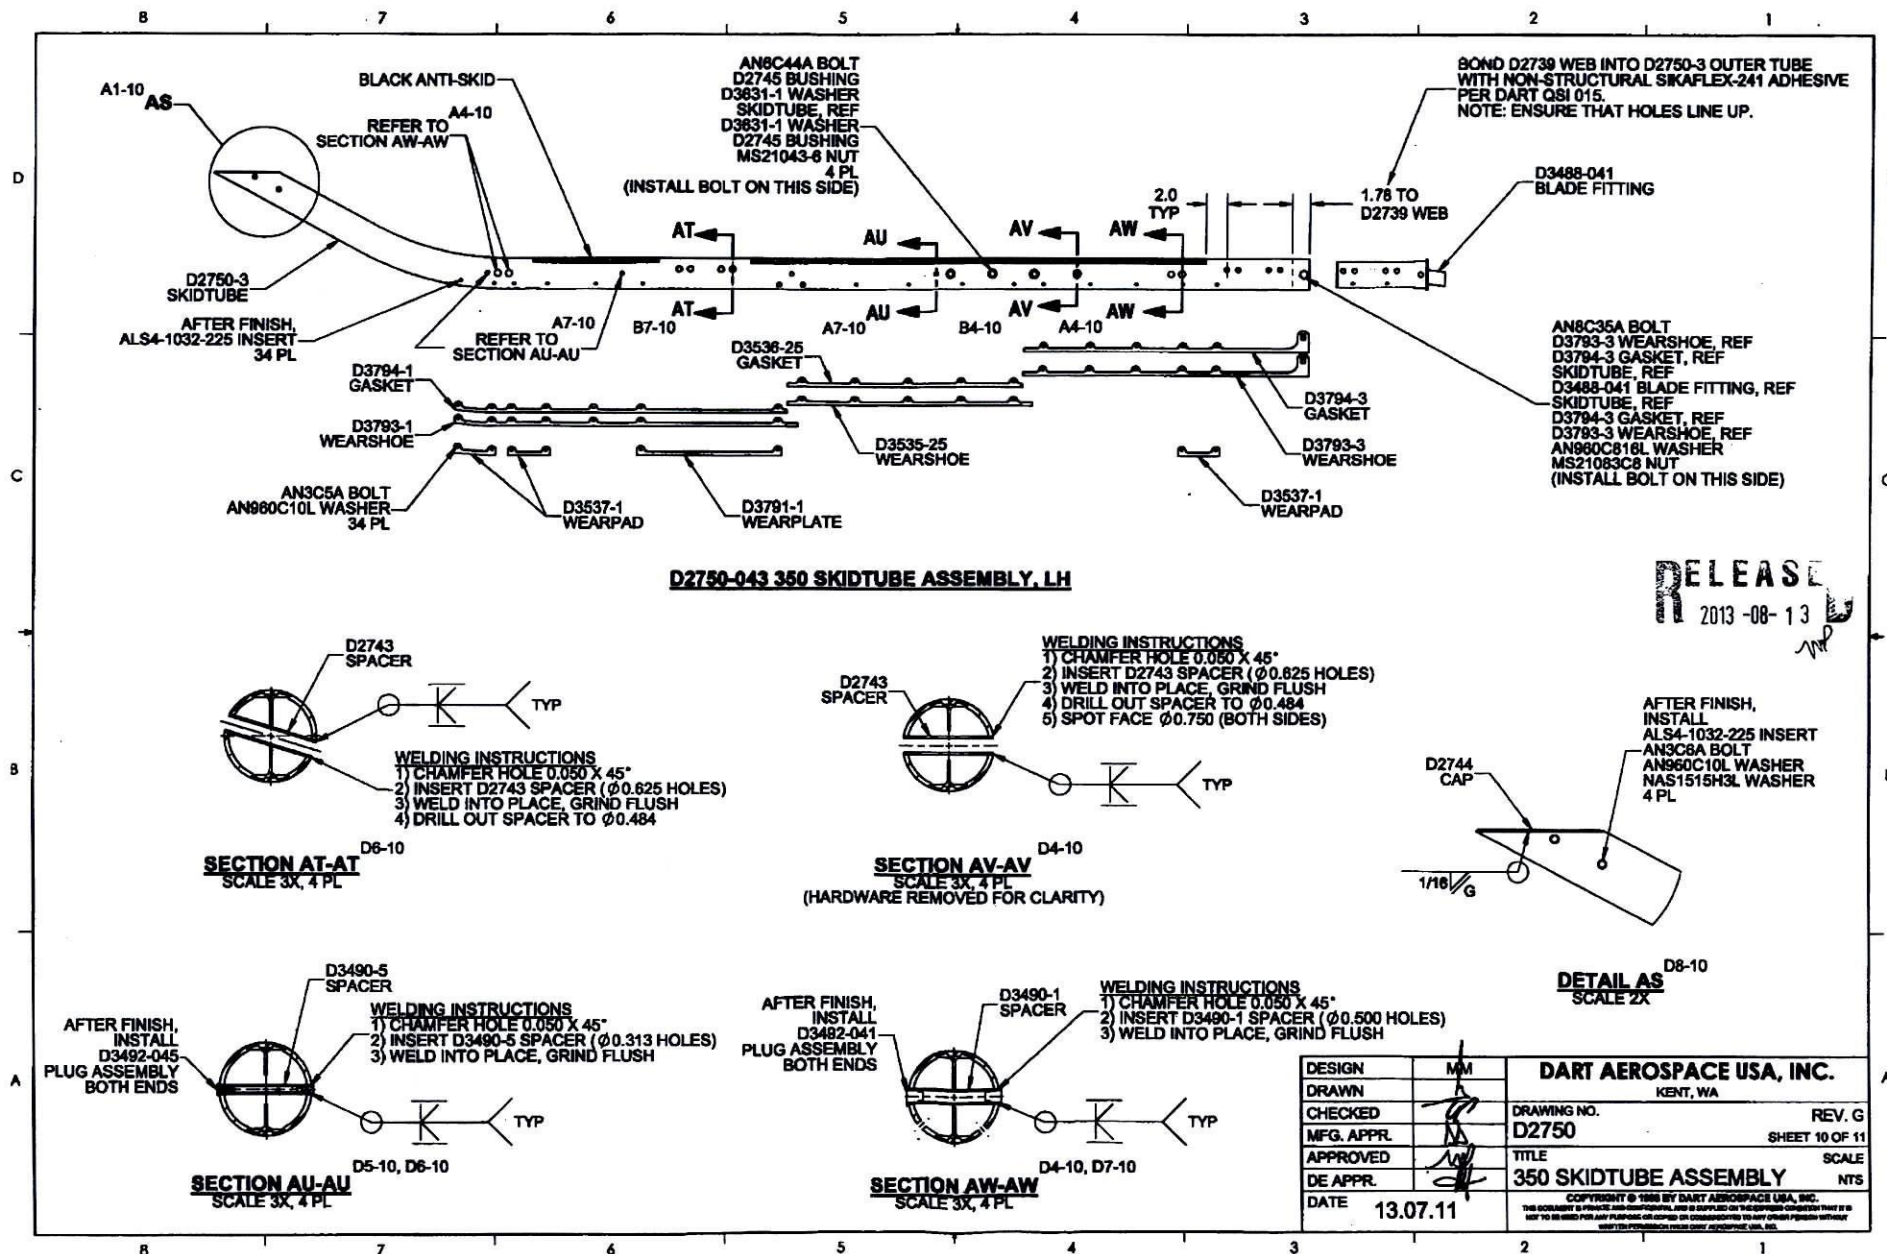

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

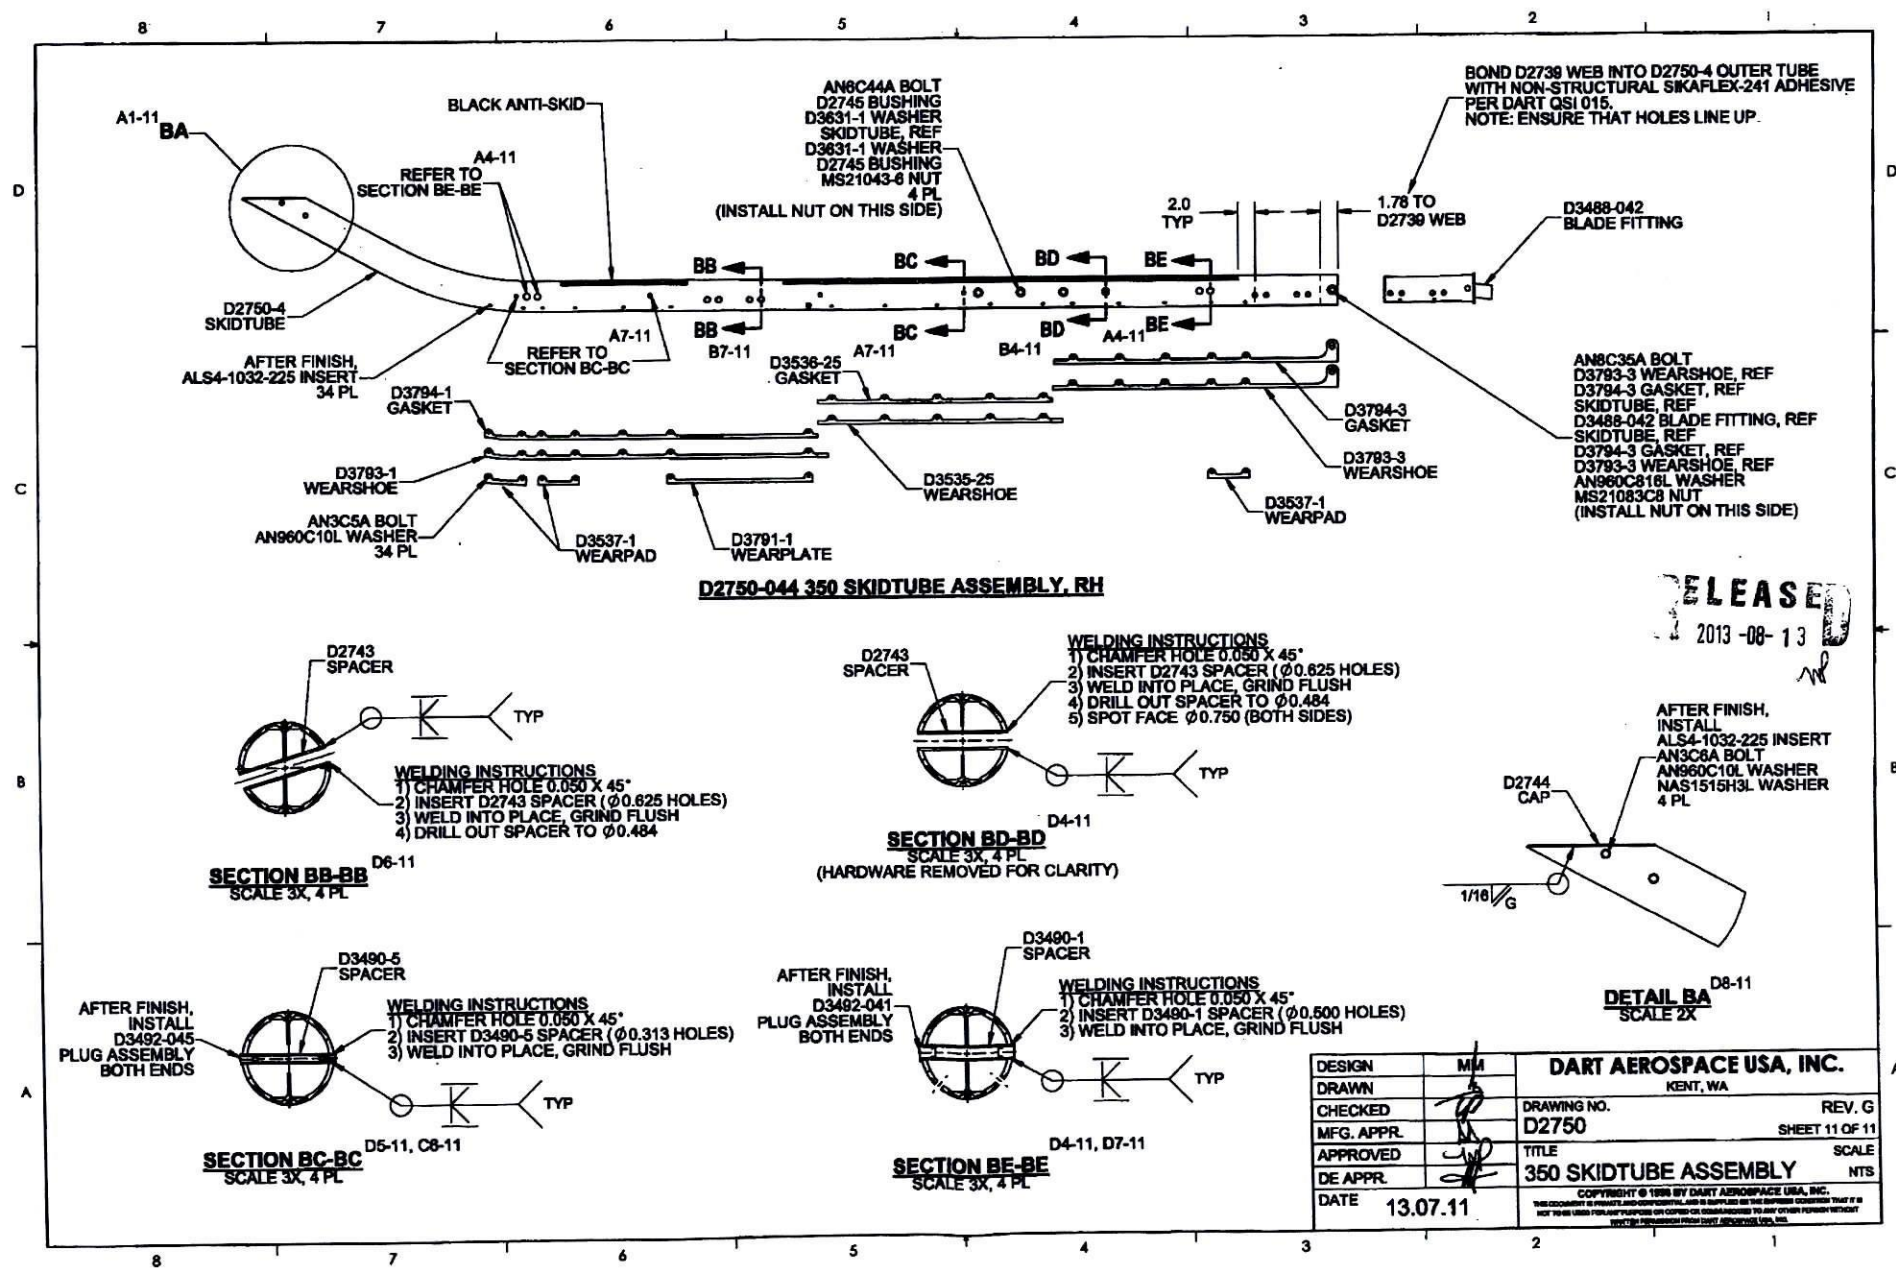

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No: _____ NCR No: _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS					
				Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐		
				Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐		
				Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐		
				Large Fab ☐	Composite ☐	Supplier ☐			
Date: _____		Step #: _____		QTY Effective: _____			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition					
				Completed By					
				Lead hand / Supervisor Approval Verification					
				QC / QA Coordinator Approval					
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐								
Misidentified ☐	Past Due ☐								
		OTHER : _____							